

Tês de redução a 90°


Reducing tees 90°

Tês de réduction à 90°

Tes 90° reducidas



01 05 1004 000

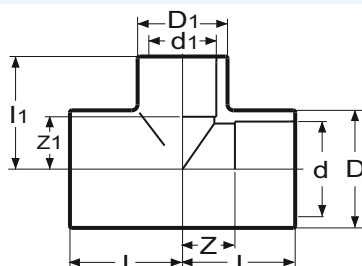

d	d1	D	D1	I	I1	Z	Z1	Gr	PN	Quant	Nº Código
20	16	26	21	28	26	11	12	19	16	B 100	01 05 1004 001
25	16	31	21	33	28	13	14	26	16	B 60	01 05 1004 003
25	20	31	25	33	30	13	13	28	16	B 60	01 05 1004 002
32	20	38	25	39	34	16	17	42	16	B 40	01 05 1004 004
32	25	38	31	39	37	16	17	45	16	B 40	01 05 1004 005
40	20	47.5	26	49	38	22	22	78	16	C 100	01 05 1004 006
40	25	47.5	32	49	41	22	22	80	16	C 90	01 05 1004 007
40	32	47.5	40	49	43	22	21	84	16	C 80	01 05 1004 008
50	20	60	26	57	44	25.5	28	143	16	C 45	01 05 1004 009
50	25	60	32	57	47	25.5	28	146	16	C 50	01 05 1004 010
50	32	60	40	57	50	25.5	28	150	16	C 45	01 05 1004 011
50	40	60	49	57	54.5	25.5	28	157	16	C 45	01 05 1004 012
63	20	75.5	26	72	50	34	33.5	280	16	C 30	01 05 1004 025
63	25	75.5	32	72	52.5	34	33.5	280	16	C 30	01 05 1004 026
63	32	75.5	40	72	56	34	33.5	283	16	C 30	01 05 1004 013
63	40	75.5	49	72	60	34	33.5	288	16	C 30	01 05 1004 014
63	50	75.5	60	72	65	34	34	299	16	C 26	01 05 1004 015
75	50	92	61	84	71	40	40	527	16	C 12	01 05 1004 016
75	63	92	77	84	78	40	40	548	16	C 12	01 05 1004 017

Tês de redução a 90°


Reducing tees 90°

Tés de réduction à 90°

Tes 90° reducidas



01 05 1004 000

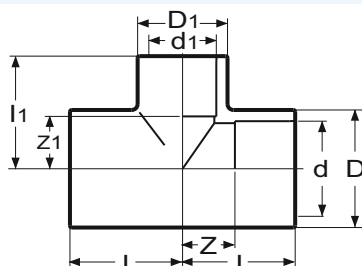

d	d1	D	D1	I	I1	Z	Z1	Gr	PN	Quant	Nº Código
90	50	109	65	99	83	48	48	865	16	E 16	01 05 1004 018
90	63	109	77	99	86	48	48	865	16	E 16	01 05 1004 019
90	75	109	92	99	92	48	48	900	16	E 16	01 05 1004 020
110	50	132	65	119	96	58	65	1417	16	E 11	01 05 1004 021
110	63	132	77	119	96	58	58	1426	16	E 11	01 05 1004 022
110	75	132	92	119	102	58	58	1451	16	E 11	01 05 1004 023
110	90	132	109	119	109	58	58	1522	16	E 9	01 05 1004 024
125	50	145	60	135	94	66	64	1680	10	E 8	01 05 1004 033
125	63	145	75	135	101	66	64	1700	10	E 8	01 05 1004 034
125	75	145	89.5	135	107	66	64	1714	10	E 8	01 05 1004 035
125	90	145	105	135	115	66	64	1740	10	E 8	01 05 1004 036
125	110	145	129	135	125	66	64	1830	10	E 8	01 05 1004 037
140	50	162	62	149	109	72	77.5	2190	10	D 6	01 05 1004 040
140	63	162	75.5	149	110	72	72	2180	10	D 6	01 05 1004 041
140	75	162	89.5	149	116	72	72	2200	10	D 6	01 05 1004 042
140	90	162	105	149	123	72	72	2222	10	D 6	01 05 1004 043
140	110	162	129	149	133	72	72	2390	10	D 5	01 05 1004 044
140	125	162	145.5	149	141	72	72	2485	10	D 5	01 05 1004 045

Tês de redução a 90°


Reducing tees 90°

Tés de réduction à 90°

Tes 90° reducidas



01 05 1004 000

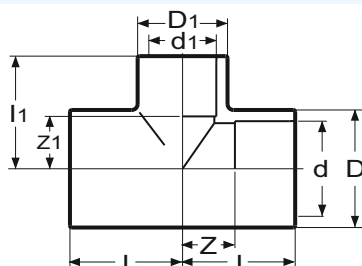

d	d1	D	D1	I	I1	Z	Z1	Gr	PN	Quant	Nº Código
160	75	188	89.5	167	125	81	81	3637	10	D 5	01 05 1004 047
160	90	188	105	167	132.5	81	81	3611	10	D 4	01 05 1004 048
160	110	188	129	167	142.5	81	81	3700	10	D 4	01 05 1004 049
160	125	188	145	167	150	81	81	3741	10	D 4	01 05 1004 050
160	140	188	162	167	158	81	81	3810	10	D 4	01 05 1004 051
200	90	227	105	210	154.5	103	103	5284	10	E 1	01 05 1004 053
200	110	227	129	210	164.5	103	103	5365	10	E 1	01 05 1004 054
200	125	227	145	210	172	103	103	5425	10	E 1	01 05 1004 055
200	140	227	162	210	180	103	103	5545	10	E 1	01 05 1004 056
200	160	227	185	210	189	103	102	5760	10	E 1	01 05 1004 057
315	160	356	188	332	253	167	167	19540	10	I 1	01 05 1004 076